

Work Order ID 160811

Thursday, May 04, 2017 2:05:07 PM

160811

OK 4/17/14

Page 1

Item ID: D4680-041

Accept

N900040100

Setup

Start

NS1

Revision ID: URF 17-547

Item Name: Skidtube Assembly

Stop

NS2

Start Date: 5/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/18/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/C

Approvals: Process Plan:

Date: MAY 04 2017 Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D4680	E U/R								

120

0.00

120

Skidtubes

Skidtubes

Memo

1.13

Skidtubes

PICK D4680-041 BENT

1-Cut Aft end as per dwg D4680

2-Deburr ends

3-Drill Aft & Fwd Cap holes using DT8678 & DT8901 open aft cap 0.187".

4-Locate DT10149 & Drill Ground wire hole on top of Tube.

5-Locate DT10149 with 0.187" cleco in aft cap, then Pilot Drill all X-Bolt holes using 0.187" drill.

6-Open ground wire hole .297" at 95.75" (1 at fwd end & 2 at aft end at 20.81" ref.)

8- 3 most fwd x-bolt holes must be laid out manually, open to #30.

9-Open Aft & Fwd Cap holes using .208" drill.

10- Open X-Bolt holes to .750" (10 places)

11- Drill Rivet Holes as per Dwg D4680 using DT10065 ***DO NOT DRILL RIVET HOLES ON SECTION G-G (TWO PLACES) Open G-G to .750

BE17-05-11

BE 1705-11

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐									

Thursday, May 04, 2017 2:05:07 PM

160811

Page 2

Accept

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 5/8/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 5/18/2017 **Req'd Qty:** 1.00 ***1***

Customer:

Reference: SCHEDULED/C

Approvals: **Process Plan:** **Date:** **Tooling:** **Date:**

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

12-Deburr holes.

BB 17-05-11

140

QC5- Inspect part completeness to step on W/O	0.00
---	------

140

OC

Memo

0.02

Quality Control

DAS
38
9-89

MAY 15 2017

150

Chemical Conversion Coat per QSI005 4.1	0.00
---	------

150

HandFinish

Memo

0.78

Hand Finishing

x1



2017/05/16
BEB

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐									

Thursday, May 04, 2017 2:05:07 PM

160811

Page 3

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
 QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐			
Power/Surge ☐ Folio Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : _____					

Work Order ID 160811

Thursday, May 04, 2017 2:05:07 PM

160811

Page 4.

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 5/8/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/18/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

170

170

Skidtubes

Skidtubes

Skidtubes

Memo

0.80

1-Bond web as per Dwg D4680 & QSI 015

A/R 241 Sike Flex

Batch:

Exp Date:

start time:

end time:

2- Seal all faying surfaces using proseal and rivet Doubler as per Dwg D4680.

A/R Proseal Batch:

exp date:

LET IT CURE FOR 7HRS

START TIME:

FINISH TIME:

3- Rivet doublers as per dwg

Shave rivet as required, remove Proseal spill over.

4- Ream holes section C-C as per dwg, deburr 8 places

5- Swage x-bolt spacers as per Dwg D4680 and sectionl C-C 8 places.

6- Swage x-bolt spacer as per dwg D4680 section G-G & boreout as per dwg

7- Trim/Grind flush per QSI 002

17-05-16
JW

JW 17-05-17

JW 17-05-18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION : Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 160811

Thursday, May 04, 2017 2:05:07 PM

160811

Page 5

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: URF 17-547 Stop ***NS2***
 Item Name: Skidtube Assembly
 Start Date: 5/8/2017 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 5/18/2017 Req'd Qty: 1.00 ***1*** Customer:
 Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 *180* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.02				<u>1</u>			DAS 38 9-86 MAY 18 2017
210 *210* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo	0.00 0.41				(x1)	Ø		2017/05/19 BFB
220 *220* Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum <u>M13716</u> Memo START TIME: <u>11:15</u> OVEN TEMPERATURE: <u>300</u> FINISH TIME: <u>11:45</u>	0.00 0.27				<u>1</u>	Ø	<u>1705-23</u>	338

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : _____									

Work Order ID 160811

Thursday, May 04, 2017 2:05:07 PM

160811

Page 6

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 5/8/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/18/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	QC3- Inspect Part Finish	0.00							
230									
QC	Memo	0.01							
Quality Control									
260		0.00							
260	HandFinishing								
HandFinish	Memo	1.01							
Hand Finishing	1- Install Ground Wire inserts as per Dwg D4680.								
	2-Inspect for Foreign objects								
	3- Install Fwd & Aft caps as per Dwg D4680 and Detail "A" & "B". Fasterner must be install wet as per note (9).								
	A/R 241 Sika Flex Batch: <u>M137526</u>								
	Exp Date: <u>2/109</u>								
	4- Wing Walk as per Dwg D4680 and QSI 005 4.4								
	Batch: <u>M137052</u>								



pto

install BSI Proseal 890 B136953
exp- 17-10-30
D17-5-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: <u>160811</u> Part No. <u>D4680-041</u> NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☒ Quality ☐ Other ☐			
Date: <u>17/5/4</u>		Step #: <u>265</u>		QTY Effective: _____		MRB (QSI042) Approval DAS 12 17/5/4 9.80 	
Description Work Order Deviation				Disposition			
<u>Install kit DSI 9775-011 per DSI 9775.</u> <u>Doublers required to increase strength of ground handling lugs.</u>				<u>Install:</u> <u>Qty(2) D5514-1 Doubler</u> <u>Qty(2) D5517-1 Pin</u> <u>Qty(76) CR3524-S-3 Rivet</u> <u>per DSI 9775 Rev. A.</u>			
				Completed By 			
				Lead hand / Supervisor Approval Verification			
				QC / QA Coordinator Approval			

Root Cause		FAULT CATEGORY									
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐								
Misidentified	☐	Past Due	☐	OTHER: _____							

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Thursday, May 04, 2017 2:05:06 PM

Page 1

Work Order ID: 160811

160811

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 5/8/2017

Required Date: 5/18/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.04.16 NEW ISSUE DD VERF:JLM IPP
REV:B 13.08.08 PB2 DD VERF:JLM IPP REV:C
13.09.10 PB3 DD VERF:JLM IPP REV:D 13.11.14
AS PER DWG REV.B DD VERF:JLM IPP REV:C 14.11.24 AS PER
DWG REV.C DD VERF:JLM IPP REV:D 15.06.10 AS PER DWG
REV.D DD VERF:JLM IPP REV:E 16.03.23 AS PER DWG REV.E
DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN526C1032R10

Purchased

No

260

Each

39.0000

2

2

AN526C1032R10

**

Screw

Location

Loc Qty

Loc Code

ST326

39

m135133

39

D5304-1

Manufactured

No

260

Each

15.0000

2

D5304-1

**

Crossbolt Spacer

Location

Loc Qty

Loc Code

LG001

15

145050

5

146516

10

17/05/24

2

17-05-18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process								
Misidentified ☐	☐ Past Due								
		OTHER :							

Picklist Print

Thursday, May 04, 2017 2:05:06 PM

Page 2

Work Order ID: 160811

160811

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 5/8/2017

Required Date: 5/18/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

260

Each

4,178.000

5

5

NAS1149C0332R

WASHER

all 1710-12x

Location

Loc Qty

Loc Code

FP001

86

m136741

46

m137178

40

GA

518

m133284

22

m136444

496

ST260a

3200

m135408

0

m135908

200

m136741

0

m137381

3000

x5

ST266

374

m136643

374

D4680-041-BENT

Manufactured

No

120

Each

2.0000

1

1

D4680-041-BFNT

Extrusion Bent

BE 17-03-11

Location

Loc Qty

Loc Code

LG002

2

146292

2

D4681-041

Manufactured

No

170

Each

7.0000

1

1

D4681-041

Web Assembly

*17-05-16
D.T.*

Location

Loc Qty

Loc Code

LG002

7

146247

7

Thursday, May 04, 2017 2:05:06 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, May 04, 2017 2:05:06 PM

Work Order ID: 160811

160811

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 5/8/2017

Required Date: 5/18/2017

Start Qty: 1.00

Required Qty: 1.00

D4686-1 Manufactured No

260 Each 102.0000 8

D4686-1

Spacer

**

8
TW 17-05-18

Location

Loc Qty

Loc Code

LG001

102

145075

82

146515

20

D4753-1 Manufactured No

260 Each 83.0000 16

D4753-1

Doubler

**

16
TW 17-05-17

Location

Loc Qty

Loc Code

LG001

80

145076

8

153498

72

LG002

3

128887

3

AEIS-1032-130 AEIS8-1032-130 Purchased No

260 Each 0.0000 3

AFI S-1032-130 X ALS4-1032-130 / MC136579 (x3)

Rivnut

**

3
TW 17-05-12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, May 04, 2017 2:05:06 PM

Page 4

Work Order ID: 160811

160811

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 5/8/2017

Required Date: 5/18/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

260

Each

1,135.000

3

3

AN3C4A

Bolt

**

all 17/05/17

Location

Loc Qty

Loc Code

FG

20

122814

20

FP001

277

M136450

23

M136740

8

M136986

20

M137075

224

M137164

2

OVER002

700

M137361

700

x3

ST350

138

M135704

138

MS20601-AD4W3

Purchased

No

260

Each

255.0000

32

32

MS20601-AD4W3

Rivet

**

8 JW 17-05-17

Location

Loc Qty

Loc Code

LG001

105

m136182

56

m137075

49

ST308

150

m137361

150

24 *

* Cannot pull full Qty

D2965

Manufactured

No

260

Each

39.0000

1

1

D2965

Cap

**

all 17/05/17

Location

Loc Qty

Loc Code

FP001

39

127852

39

x1

Thursday, May 04, 2017 2:05:06 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : _____									

Picklist Print

Thursday, May 04, 2017 2:05:06 PM

Page 5

Work Order ID: 160811

160811

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 5/8/2017

Required Date: 5/18/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

260

Each

1,462.000

2

2

AN3C5A

Bolt

**

all 12/05/12

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

168

M136450

2

M136579

66

M137164

100

OVER002

1150

M136182

100

M137361

800

M137412

250

ST350

139

M134676

1

M135442

138

D2965-3

Manufactured

No

260

Each

72.0000

1

1

D2965-3

Cap

**

all 12/05/12

Location

Loc Qty

Loc Code

FP001

72

72

CR3524-5-3 X 80 B. 126369 137429 137587 52 23 +3

DSS14-1 X 2 B: 160446

DSS17-1 X 2 B: 160447 TW 17-05-18

Thursday, May 04, 2017 2:05:06 PM

Shop Packet Print

Page 5

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : _____									


ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER (AN960-10L)

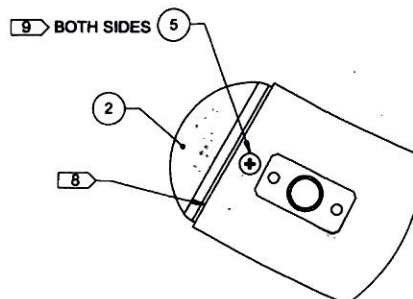

DETAIL A
SCALE 4X

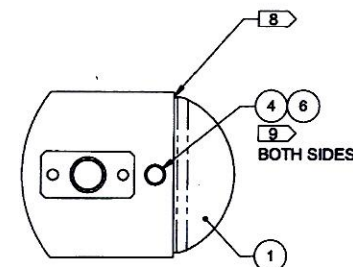

DETAIL B
SCALE 4X

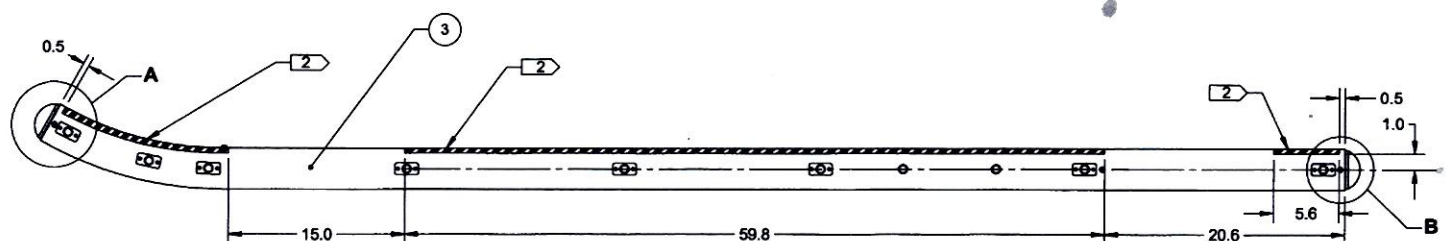

D4680-041 SKIDTUBE

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 160811

MAY 04 2017

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 18.56 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT

UNDER REVIEW

URF 17-547 ML


RELEASED

2016-02-04

EW 16-514


E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED, WAS WELDED. REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE. ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149F0332P WAS AN960-10L. AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3, VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051. SWAGING DIMENSION NOW 0.850 WAS 0.861 (D6-2). ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR DRAWING NO. D4680 SKIDTUBE SHEET 1 OF 3 SCALE NTS COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	DD		
APPROVED	WM		
DE APPR.	DS	REV. E 15.11.02	

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	SPACER
6	3	AELS-1032-130	INSERT
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER (AN960-10L)

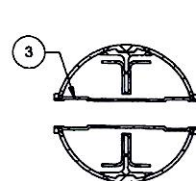



SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D
1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000 \times 1.0$
3. DEEP PER QSI 002
TRIM/GRIND FLUSH PER QSI 002

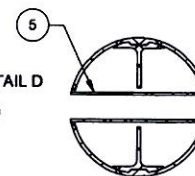


SECTION G-G
SCALE 4X
2 PL

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)
1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 +0.005/-0.000 \times 1.0$
3. OPEN THRU HOLE TO $\phi 0.625$

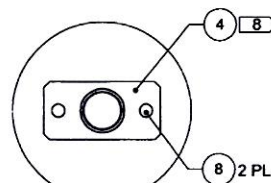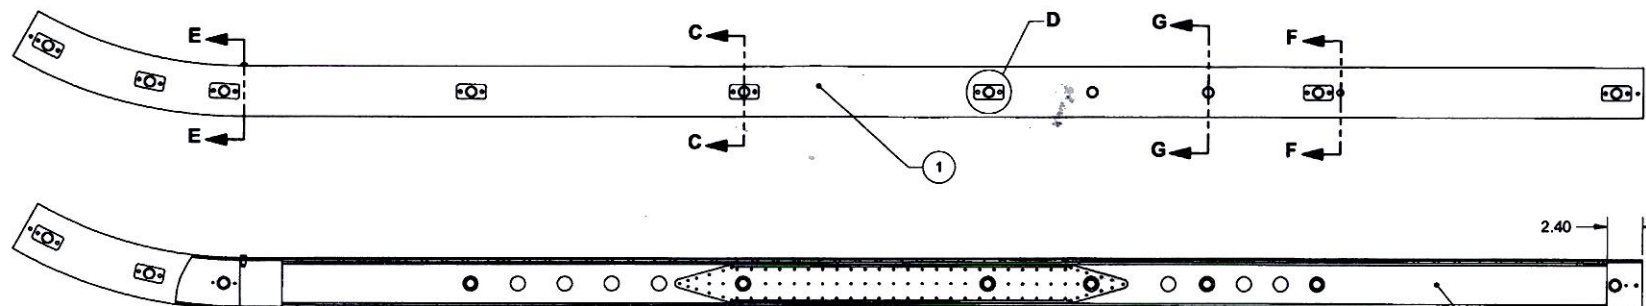


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

D4680-043 SKIDTUBE SUB ASSY

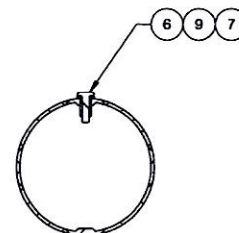

SECTION E-E
SCALE 2.5X

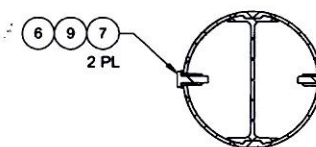

SECTION F-F
SCALE 2.5X

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB.
POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 17.91 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS


UNDER REVIEW

URF 17-547 ML



RELEASED
2016-02-04

APPROVED


DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	EUGENE, OR	
CHECKED	AJS	DRAWING NO.	REV. E
MFG. APPR.	DD	D4680	SHEET 2 OF 3
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	15.11.02	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

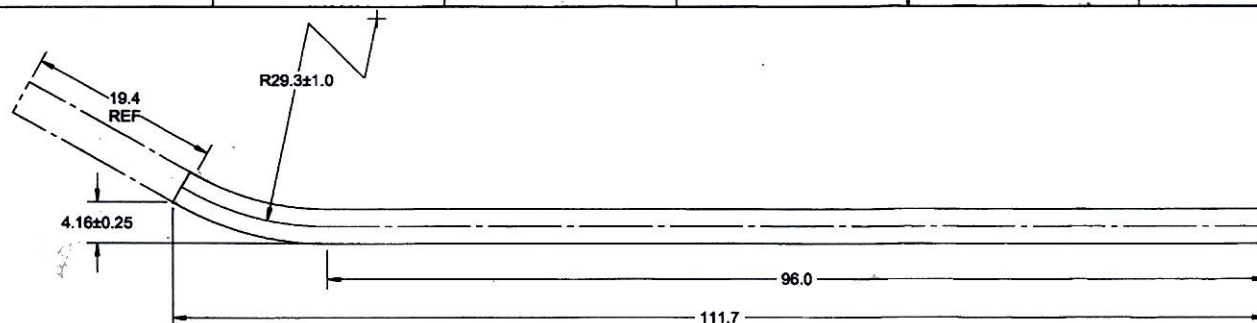


D4680-1 SKIDTUBE BENDING/TRIMMING DETAIL

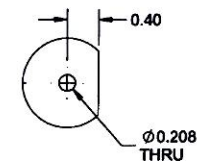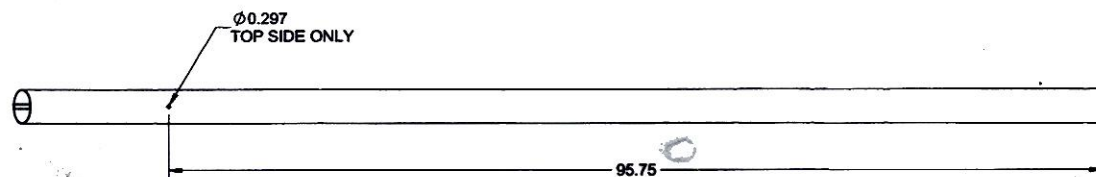

DETAIL H
SCALE 8X
2 PL

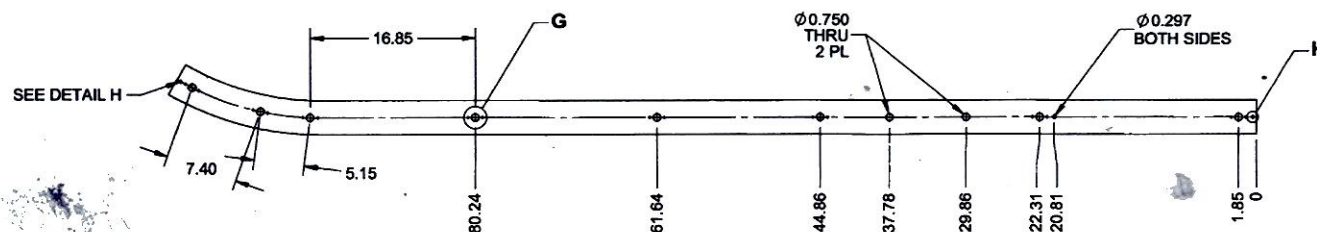

D4680-1 SKIDTUBE DRILLING DETAIL

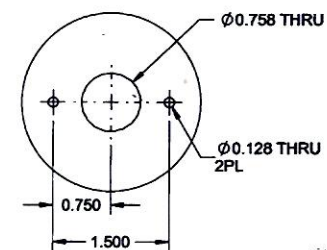

DETAIL G
SCALE 8X
8 PL

- NOTES:**
- 1) MATERIAL: MAKE FROM D2962-150 EXTRUSION
 - 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: NONE
 - 7) WEIGHT: 11.36 lbs

UNDER REVIEW

URF 17-547 ML

RELEASED
2016-02-04

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	EUGENE, OR	
CHECKED	AJS	DRAWING NO.	REV. E
MFG. APPR.	DD	D4680	SHEET 3 OF 3
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	15.11.02	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	